




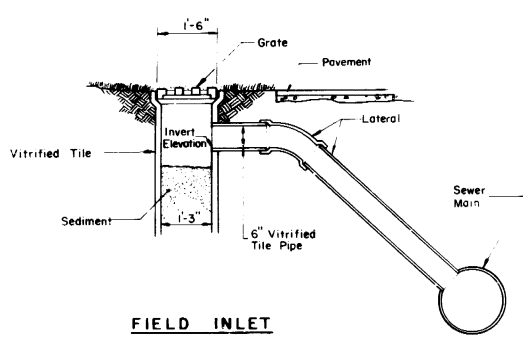

FIELD INLET

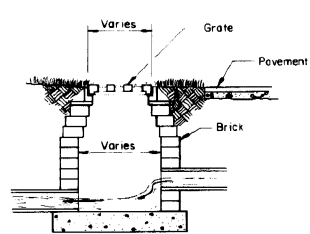


MANHOLE

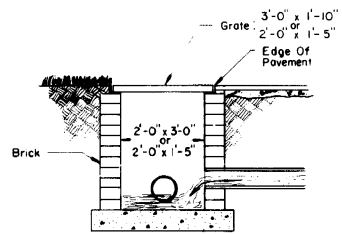

DROP INLET

EXISTING STORM SEWER STRUCTURES
N.T.S.

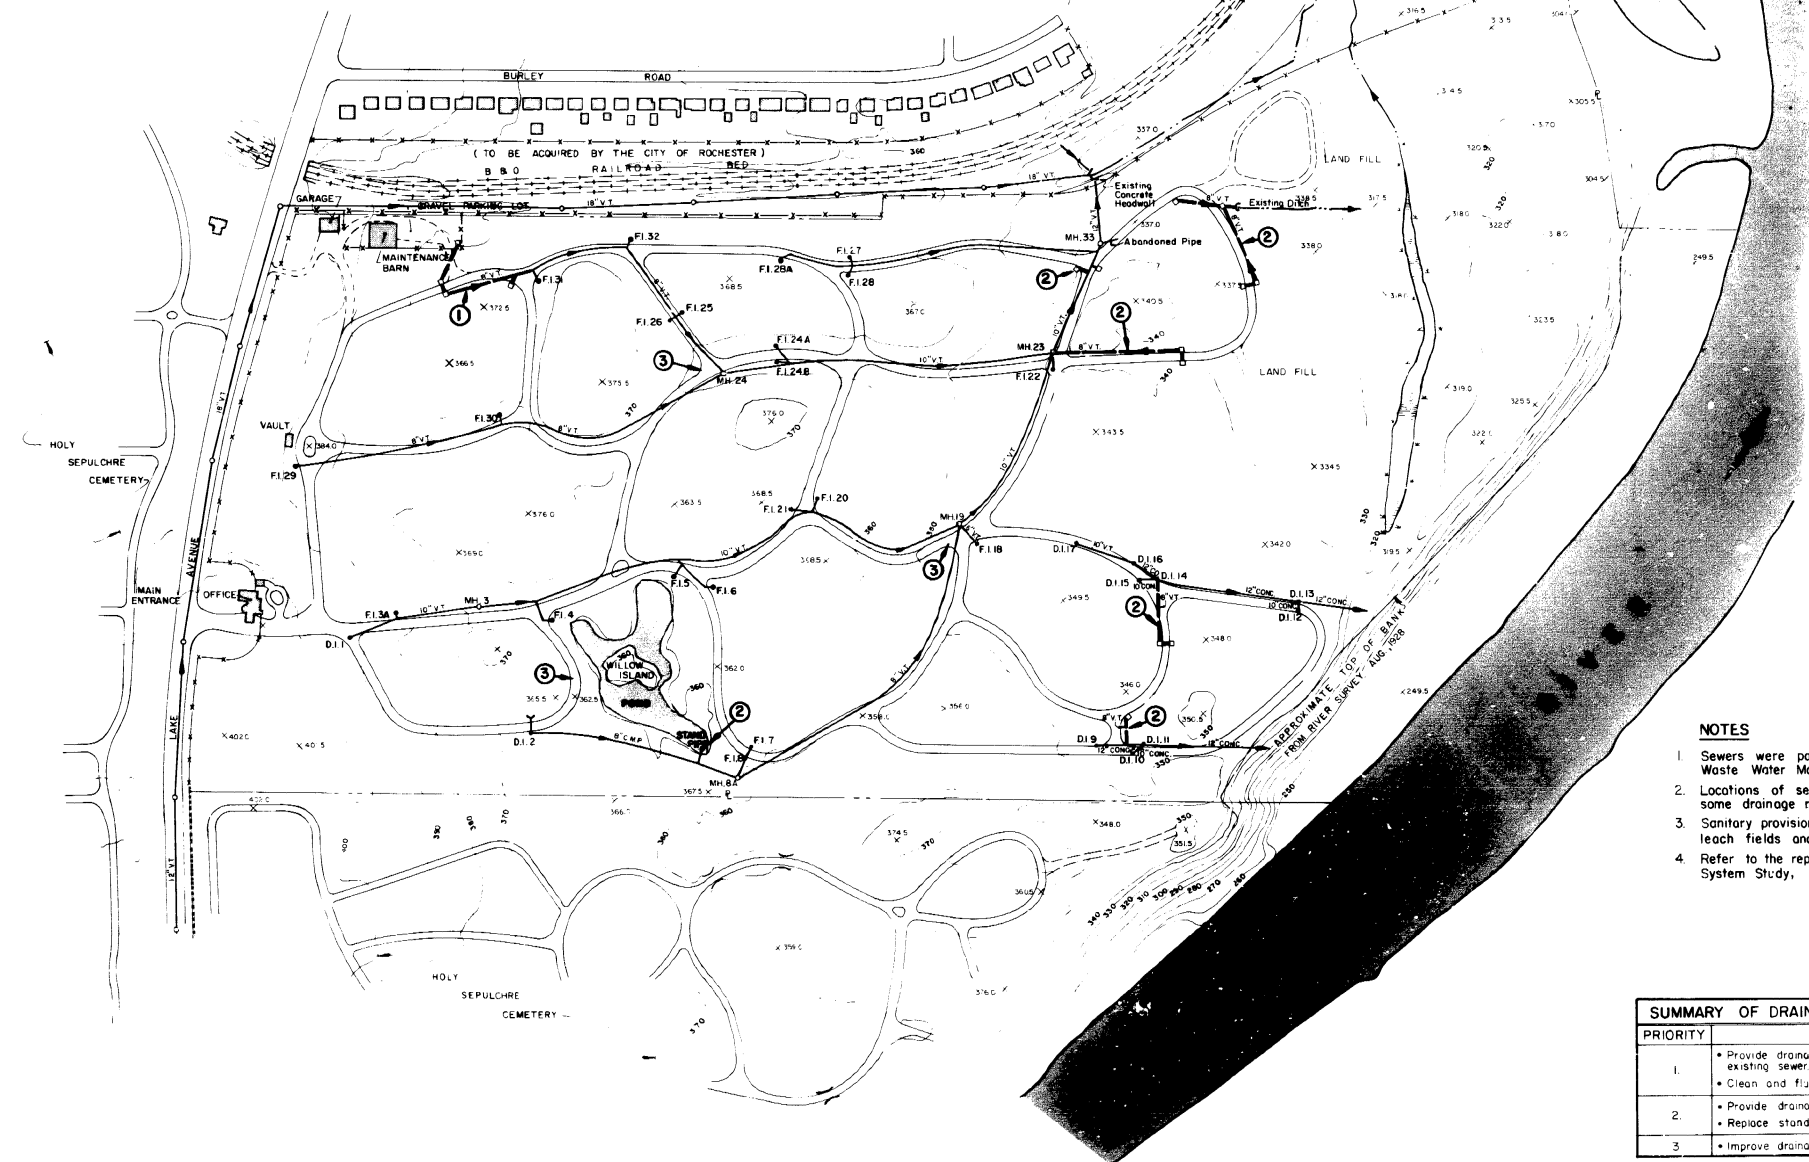


- LEGEND**
- ASPHALT PAVEMENT
 - - - UNIMPROVED DIRT OR GRAVEL ROAD
 - - - ABANDONED RAILWAY
 - FENCE
 - BUILDING
 - STONE WALL
 - FI.2 FIELD INLET
 - DI.2 DROP INLET
 - OMH.9 MANHOLE
 - OPEN DITCH
 - SEWER LINE (Existing)
 - PIPE OUTLET
 - PROPOSED SEWER LINE AND INLET
 - ① PRIORITY RANKING

- NOTES**
- Sewers were partially cleaned by Monroe County Department of Waste Water Management between 9/30/81 and 10/6/81.
 - Locations of sewer lines may vary. Dye tests were used to verify some drainage runs but were not always conclusive.
 - Sanitary provisions for the Office and Maintenance Barn consist of leach fields and septic tanks.
 - Refer to the report entitled, "Roadway, Storm Sewer and Water System Study, Riverside Cemetery," for additional information.

SUMMARY OF DRAINAGE SYSTEM RECOMMENDATIONS	
PRIORITY	RECOMMENDATIONS
1.	- Provide drainage inlets near maintenance barn. Connect to existing sewer. - Clean and flush the remaining sewer system.
2.	- Provide drainage inlets where significant ponding is observed. - Replace stand pipe in pond.
3.	Improve drainage where minor ponding is observed.

FILE NO.		
NO.	REVISIONS	BY DATE

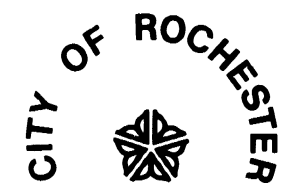

DEPARTMENT OF
ENVIRONMENTAL
SERVICES

**SEELYE STEVENSON
VALUE & KNECHT, INC.**

ENGINEERS AND PLANNERS
ROCHESTER, NEW YORK

PROJECT CONTRACT

**ROADWAY, STORM SEWER,
AND
WATER SYSTEM STUDY**

**MOUNT HOPE
AND
RIVERSIDE
CEMETERIES**

SHEET TITLE
**EXISTING STORM
SEWERS AND
RECOMMENDATIONS**

**RIVERSIDE
CEMETERY**

3618-045-40000-000-05-D	
DRAWN BY W. A. T.	SCALE 1" = 200'
DESIGNED BY R. T. V.	DATE OCTOBER, 1981
CHECKED BY N. A. P.	
APPROVED BY R. J. R.	Sheet 3 of 4